

520 Eagleton Downs Drive - D Pineville, NC 28134 O: 704.405.2550

F: 704.543.9772

www.americanflamecoat.com

Client: ROYSONS CORPORATION 40 VANDERHOOF AVENUE ROCKAWAY, NJ 07866

Date: November 8, 2021 Test Report No: 100654

PO# 33222

The sample submitted by the client as: ROYSONS CORPORATION – NOLAR NON-VINYL WALLCOVERING. (ADHERED)

DATE OF RECEIPT: 11.02.2021

TESTING PERIOD: 6 DAYS

TEST REQUESTED: The submitted sample was tested for flammability in accordance with the procedures outlined in ASTM E-84-19b.

SIGNED

Miles Topley !





520 Eagleton Downs Drive - D Pineville, NC 28134 O: 704.405.2550

F: 704.543.9772

www.americanflamecoat.com

Client: ROYSONS CORPORATION 40 VANDERHOOF AVENUE ROCKAWAY, NJ 07866

Date: November 8, 2021

INTRODUCTION:

This report presents test results of Flame Spread and Smoke Developed Value per ASTM E-84-19b. The report also includes Material Identification, Method of Preparation, Mounting and Conditioning of the specimens.

The tests were performed in accordance with the specifications set forth in ASTM E-84-19b, Standard Test Method for Surface Burning Characteristics of Building Materials, both as to equipment and test procedures. This test procedure is similar to UL-723, ANSI NO. 2.5, NFPA No. 255 and UBC 42-1. The test is applicable to exposed interior surfaces such as walls and ceilings.

The test results cover two parameters: Flame Spread and Smoke Developed Values during the 10-minute fire exposure. Inorganic cement board and red oak flooring are used as comparative standards and their responses are assigned arbitrary values of 0 and 100 respectively.

PREPARATION AND CONDITIONING:

The test sample identified as ROYSONS CORPORATION – NOLAR NON-VINYL WALLCOVERING - (ADHERED) was prepared by adhering the material to 5/8" Standard IC board, glued using FR - Shur-Stik wallcovering adhesive. This method of sample preparation is described in ASTM E2404-15A, standard practice.

TEST PROCEDURE: Adhered

The tunnel was thoroughly pre-heated by burning natural gas. When the brick temperature, sensed by a floor thermocouple, had reached the prescribed 105 Fahrenheit +/- 5 Fahrenheit level, the sample was inserted in the tunnel and a test conducted in accordance with the standard ASTM E-84-19b procedures.

The operation of the tunnel was checked by performing a 10-minute test with inorganic board of the day of the test.

This test sample *meets the A.S.T.M. E-84-19 Standard.

This test sample *meets the N.F.P.A. LIFE SAFETY CODE 101.



520 Eagleton Downs Drive - D Pineville, NC 28134

O: 704.405.2550 F: 704.543.9772

www.americanflamecoat.com

Client: ROYSONS CORPORATION 40 VANDERHOOF AVENUE ROCKAWAY, NJ 07866

Date: November 8, 2021

TEST RESULTS:

The test results calculated in accordance with ASTM E-84-19 for Flame Spread and Smoke Developed Values are as follows:

Test Specimen: ROYSONS CORPORATION – NOLAR NON-VINYL WALLCOVERING (ADHERED)

Flame Spread Index = 10 Smoke Developed Value = 90

Observation: Tested Fabric Meets the Requirements for ASTME-84-19b

Rating: Class A

The National Fire Protection Association Life Safety Code 101, Section 6-5.3, "Interior Wall and Ceiling Finish Classification", has a means of classifying materials with respect to Flame Spread and Smoke Developed when tested in accordance with NFPA 255, "Method of Test of Surface Burning Characteristics of Building Materials", (ASTM E-84)


The classifications are as follows:

Class A Interior Wall & Ceiling Finish:	Flame Spread-	0-25
_	Smoke Developed-	0-450
Class A Interior Wall & Ceiling Finish:	Flame Spread-	0-25
	Smoke Developed-	0-450

Client:

Report#: Sample:


ROYSONS CORPORATION 100654 NOLAR NON-VINYL WALLCOVERING 23912 - (ADHERED)

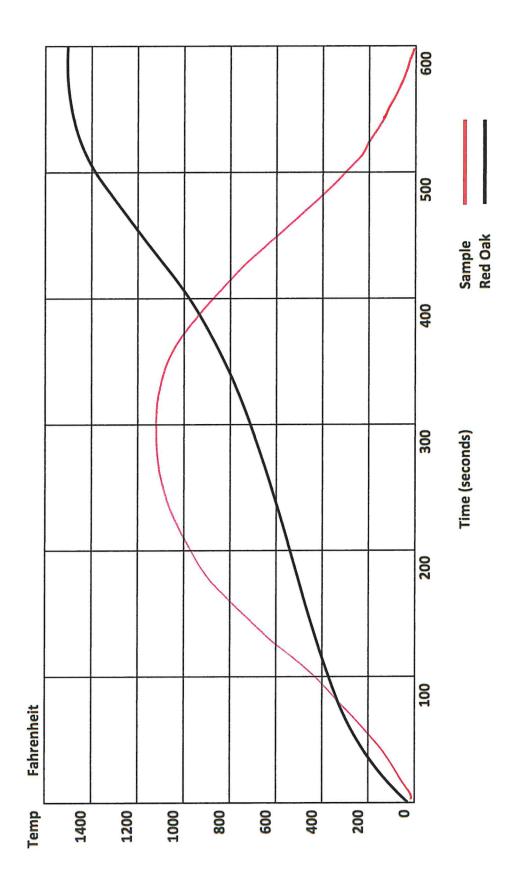

Client:

Report#: Sample:

ROYSONS CORPORATION 100654 NOLAR NON-VINYL WALLCOVERING 23912 - (ADHERED)

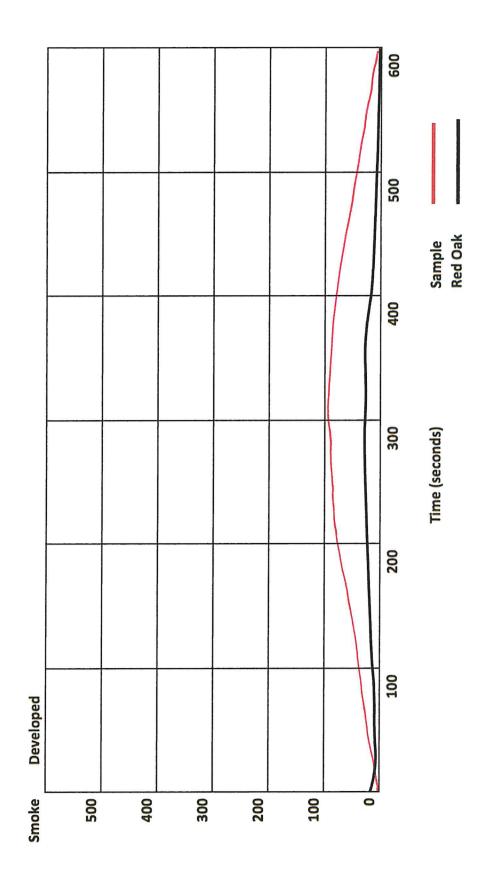

ROYSONS CORPORATION 100654 NOLAR NON-VINYL WALLCOVERING 23912 - (ADHERED) Client: Report#: Sample:

